

TO NC

	<u> </u>		Ь.			ł			/		8			
	COUNT	DESCRIPTIO	N OF REVISIONS	BY	CHKD	DATE	cor	UNT	DESCRIPTION OF	REVISIONS	BY	CHKD	DATE	
igwedge							4							
\triangle					-									
\triangle														

	PART NUMBER	CL NUMBER	NUMBER OF	DIMEN PATTE	ISION OF (IRN, AND N	CONNECTOR, METAL MASK		DIMENSION OF DRAWING FOR PACKING						DIMENSION OF RECOMMENDED FPC		
			CONTACT	А	В	С	n	D	E	F	G	Н	J	K	L.	М
\triangle	FH29B-34S-0.2SHW(05)	CL580-0312-2-05	34	8.62	6.4	7.24	17	9.62	11.5	_	24	25.4	29.4	8.06	7.2	6.87
	FH29B-40S-0.2SHW(05)	CL580-0313-5-05	40	9.82	7.6	8.44	20	10.82	11.5	-	24	25.4	29.4	9.26	8.4	8.07
	FH29B-44S-0.2SHW(05)	CL580-0314-8-05	44	10.62	8.4	9.24	22	11.62	11.5	-	24	25.4	29.4	10.06	9.2	8.87
\triangle	FH29B-50S-0.2SHW(05)	CL580-0315-0-05	50	11.82	9.6	10.44	25	12.82	11.5	-	24	25.4	29.4	11.26	10.4	10.07
	FH29B-60S-0.2SHW(05)	CL580-0316-3-05	60	13.82	11.6	12.44	30	14.82	11.5	-	24	25.4	29.4	13.26	12.4	12.07
\triangle	FH29B-70S-0.2SHW(05)	CL580-0317-6-05	70	15.82	13.6	14.44	35	16.82	11.5		24	25.4	29.4	15.26	14.4	14.07
^	FH29B-80S-0.2SHW(05)	CL580-0318-9-05	80	17.82	15.6	16.44	40	18.82	14.2	28.4	32	33.4	37.4	17.26	16.4	16.07
	FH29B-90S-0.2SHW(05)	CL580-0319-1-05	90	19.82	17.6	18.44	45	20.82	20.2	40.4	44	45.4	49.4	19.26	18.4	18.07
1	FH29B-100S-0.2SHW(05)	CL580-0320-0-05	100	21.82	19.6	20.44	50	22.82	20.2	40.4	44	45.4	49.4	21.26	20.4	20.07
i	FH29B-120S-0.2SHW(05)	CL580-0321-3-05	120	25.82	23.6	24.44	60	26.82	20.2	40.4	44	45.4	49.4	25.26	24.4	24.07
											P			,		

г						1					
NO.	MATE	RIAL	FINISH,	REMARKS	S	NO.	MATER	IAL	F	FINISH, RE	MARKS
	CODE NO.(OLD) CL				DRAWN		DESIGNED	CHECKE	D	APPROVED	RELEASED
	DIMENSION CHART				T.M00	GI	T.MOG1	N.NISHIM	ATSU	M.ISHIDA	·
					07.04.19		07.04.19	07.04.19		07.04.20	
	DRAWING NO.					PART					
SCALE EDC3-15				04-0	1		FH29B	29B-**S-C		.2SHW(05)

KS

CODE NO.

HIROSE ELECTRIC CO., LTD

CL580

2

3

8 FORM NO.233

This connector is small and thin and requires delicate and careful handling. Read through the instructions shown below and handle the connector properly. Each values indicating here are for reference and may differ from standard value.

I INSTRUCTIONS FOR MOUNTING ON THE BOARD 1

◆Warp of Board

Minimize warp of the board as much as possible. Lead co-planarity including reinforced metal fittings is 0.1 mm or less. Too much warp of the board may result in a soldering failure.

◆Load to Connector

Do not apply a force of 0.5 N or more to the connector before mounting it on the board. Otherwise, the connector may be broken.

Do not insert the FPC or operate the connector before mounting it.

◆Lord to Board


· Splitting a large board into several pieces


- Screwing the board


Avoid the handling described above so that no force is exerted on the board during the assembly process. Otherwise, the connector may become defective.

◆ Amount of Warp

The warp of a 100-mm wide board should be 0.5 mm or less. The warp of board suffers stress on connector and the connector may become defective.

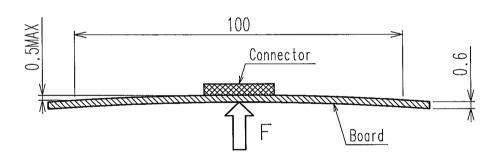

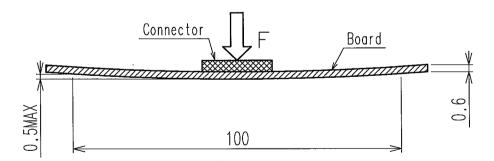


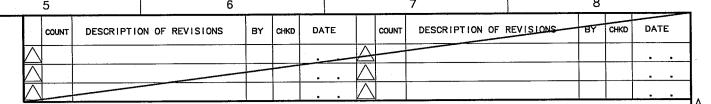

[INSTRUCTIONS ON INSERTING FPC AND CONNECTION]

◆ Use of the Lock Lever


1. Be very careful not to apply excessive force when releasing the lock lever in the initial position (with no FPC inserted). If you use your nail or finger as shown below, the terminals may be deformed.

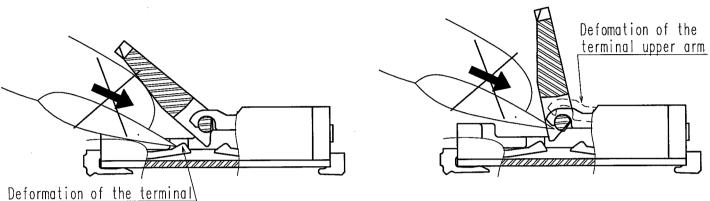

Example 1


Example 2

2. The lock lever rotates around the rotational axis as shown below. Rotate the lock lever.

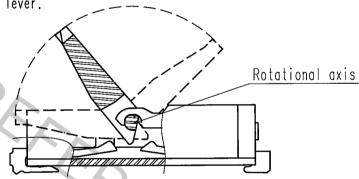

3. The lock lever will not open more than 135°.

Do not apply any force backward beyond this point. Otherwise, the lock lever may come off or break.

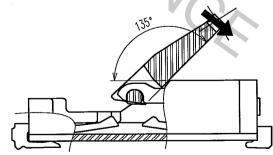

CODE NO.(OLD)	DRAW	١	DESIGNED	CHECKED	APPROVED	RELEA	ASED	
INIC	T.MOG	SI	T.MOGI	N.NISHIMATSU	M.ISHIDA			
INS	TRUCTION MANUAL	07.04.	.19	07.04.19	07.04.19	07.04.20	•	
⊕ €	DRAWING NO.		PAR	NO.				
SCALE				FH29B-	-**S-0.	2SHW(C)5)	
FREE UNITS			CODE NO.					5/
mm	HIROSE ELECTRIC CO.,	LTD	_{ьть} СL580					


NC

8 FORM NO. 233

NC

В

4. Move the lock lever at approximately the center.
(It may break if operate the edge of the lock lever with FPC inserted.)
5. Do not pinch or pick the lock lever to lift it as shown below. Otherwise, it may break.
(Do not carry out any operation other than rotating the lever as shown in 2 above.)

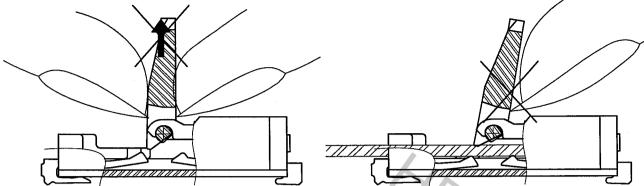



◆Direction of Contacts

This connector has contacts on the bottom. Thus, insert it with the exposed conductors face down.

◆ Inserting the FPC

Insert the FPC by about 10 degrees along the surface and at a right angle to the connector.
 Insert it properly to the very end.
 If the FPC is inserted at a slant (incorrectly),
 the conductors may short-circuit due to pitch shift or the edge of the FPC may catch in the terminals,
 resulting in deformation of the terminals.

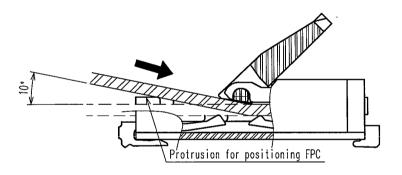

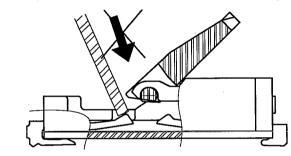


Do not insert the FPC diagonally from above.
 If the FPC is inserted at a slant (incorrectly) as shown below in the FPC insertion process,
 the FPC may bend and patterns may break or the FPC may not insert completely,
 resulting in improper conduction.

**Keep a sufficient FPC insertion space in the stage of the layout in order to avoid incorrect FPC insertion.

Besides, it is not difficult to insert FPC correctly all the way to the end.

Design the proper layout of parts.

****** Make adjustments with the FPC manufacturer for FPC bending perfomance and wire breakage.

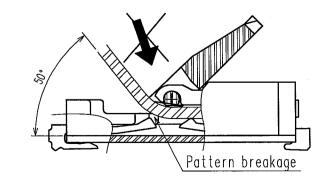

◆ Checking the Locking Condition
In the locked condition, make

In the locked condition, make sure that the lock lever is horizontal on the board surface. Do not apply excessive force to it near the 0° position of the lever.


Otherwise, the terminals may be deformed. (Allowable force: 1 N or less)

		J		•						•	L				
T		COUNT	DESCRIPTIO	ON OF REVISIONS	BY	CHKD	DATE		COUNT	DESCRIPTION OF I	REVISIONS	BY	CHKD	DAT	Ε
	$\overline{\ }$							\triangle							
								\triangle							

[INSTRUCTIONS ON FPC LAYOUT AFTER CONNECTION]

◆Load to FPC

Be very careful not to apply any force to the FPC after inserting it.
Otherwise, the connector may become unlocked or the FPC may break.
Fix the FPC, in particular, when loads are applied to it continuously.
Design the FPC layout with care not to bend it sharply near the insertion opening.

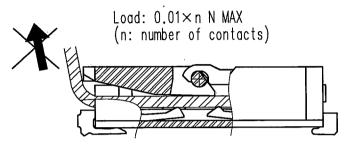


[INSTRUCTIONS ON REMOVING FPC]

◆Release the lock lever at approximately the center.

(It may break if operate the edge of the lock lever with FPC inserted.)

◆Release the lock lever to remove the FPC.

Remove the FPC by about 10 degrees along the surface.

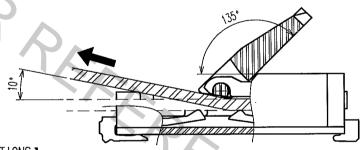

[OTHER INSTRUCTIONS]

◆ Instructions on Manual Soldering

Follow the instructions shown below when soldering the connector manually during repair work, etc.

1. Do not perform reflow soldering or manual soldering with the FPC inserted into the connector.
2. Do not heat the connector excessively. Be very careful not to let the soldering iron contact

2. Do not heat the connector excessively. Be very careful not to let the soldering iron contact any parts other than connector leads. Otherwise, the connector may be deformed or melt.

3. Do not use excessive solder (or flux).
If excessive solder (or flux) is used on the terminals, solder or flux may adhere to the contacts or rotating parts of the lock lever, resulting in poor contact or a rotation failure of the lock lever.

CODE NO.(OLD)	` '			CHECKED	APPROVED	RELEA	SED
INC	TOUCTION MANUAL	T.MOGI	T.MOGI	N.NISHIMATSU	M.ISHIDA		
INS	TRUCTION MANUAL	07.04.1	19 07.04.19	07.04.19	07.04.20	•	•
® =	DRAWING NO.		PART NO.		,		
SCALE			FH29B	-**S-0.	2SHW(C)5)	
FREE	HRC .		CODE NO.	CL 58	Ω		6/

] FH

4

6

7

8 FORM NO.